



Ford Ka + 2 Airbags (from 12/06/2018)
VIN 9B9BFZH55U7K8206502



22.83 max. 34.00 - Adult Occupant



35.41 max. 49.00 - Child Occupant

FRONTAL 11.54 Points (max. 16.00)

SIDE 10.80 Points (max. 16.00)

CAR DETAILS

Tested model: Ford Ka

Year of publication: 2018

Made in: Brazil

Body type: 5 door Hatchback

Crash test weight: 1279 kg

Test valid for: Latin NCAP market


SAFETY EQUIPMENT

Driver frontal airbag	YES	Driver knee airbag	NO
Front passenger frontal airbag	YES	Front seatbelt pretensioners	YES
Side head airbags DRIVER	NO	Front seatbelt pretensioners pass	YES
Side head airbags PASSENGER	NO	SBR	Driver
Side body airbags DRIVER	NO	ISOFIX anchorages	YES
Side body airbags PASSENGER	NO	ABS (4 channel)	YES
Side Curtain airbags	NO	ESC (UN13 or GTR8)	NO




ADULT OCCUPANT PROTECTION

ODB FRONTAL

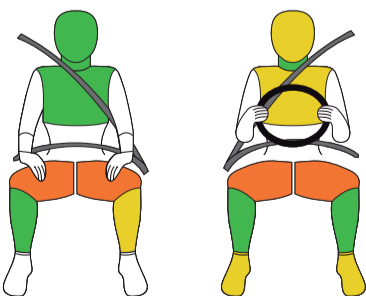

FRONT PASSENGER DRIVER

MBD SIDE

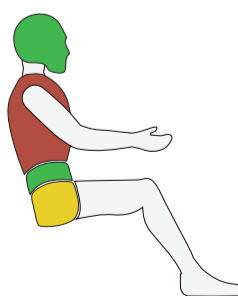

POLE SIDE



PROTECTION GOOD ADEQUATE MARGINAL WEAK POOR

BODYSHELL INTEGRITY STABLE

SIDE IMPACT PROTECTION (STRUCTURAL) YES

COMMENTS

Adult occupant: Frontal impact: The driver head had adequate protection as the driver head bottomed out the airbag. Passenger's head protection was good. Driver and Passenger's neck protection was good. Driver's chest protection was adequate, while passenger's chests received good protection from the restraint systems. Only driver seatbelts was equipped with pretensioner. Driver and Passenger knees showed marginal protection as they were exposed to reach dangerous structures behind the fascia. Driver and Passengers tibias showed good and adequate protection. Driver feet showed adequate protection. Footwell area is unstable. The bodyshell was rated as stable. The car has seatbelt pretensioner only in driver side. Side impact: The car offered good protection to head and abdomen, adequate protection for the pelvis, and weak protection in the chest. The rear door opened during the side impact. The car is not equipped with ESC according to Latin NCAP requirements. Side pole impact test was not performed, the car does not offer side head protection airbags as standard. All of the above explains the 3 stars in adult Occupant protection.



CHILD OCCUPANT PROTECTION

Dynamic score:
23.41 (max 24)

Installation score:
12.00 (max 12)

Vehicle assessment score:
0.00 (max 13)

CHILD RESTRAINT SYSTEM

	CHILD RESTRAINT	DYNAMIC SCORE	CRS TYPE	ADJUST	POSITION
18 month old child	Römer BabySafe + ISOFIX Base	Frontal 8.00(8 max) Side 4.00 (4 max)	0+	ISOFIX/LEG	RWF
3 year old child	Römer Duo Plus	Frontal 7.41 (8 max) Side 4.00 (4 max)	1	ISOFIX/TT	FWF

CRS INSTALLATION ASSESSMENT

REFERENCE LIST		2ND ROW			
		RIGHT	LEFT	CENTER	RIGHT
Group 0+	Peg Perego Viaggio Switchable	Exempt	Pass	Exempt	Pass
Group 0+	Roemer Baby Safe	Exempt	Pass	Exempt	Pass
Group 0+	Bébé Confort Streety Fix / Maxi Cosi Citi SPS	Exempt	Pass	Exempt	Pass
Group I	Peg Perego Viaggio Switchable FWF	Exempt	Pass	Exempt	Pass
Group I	Graco Cadeira Nautilus FWF	Exempt	Pass	Exempt	Pass
Group II/III	Burigotto Multipla 1,2,3	Pass	Pass	Exempt	Pass
Group II/III	Graco Cadeira Nautilus	Pass	Pass	Exempt	Pass
MANUFACTURER		RIGHT	LEFT	CENTER	RIGHT
Q1.5	Römer BabySafe + ISOFIX Base	Exempt	Pass	Exempt	Pass
Q3	Römer Duo Plus	Exempt	Pass	Exempt	Pass

COMMENTS

Child occupant: The CRS for the 3-year-old child was able to prevent excessive forward movement during the impact and offered good protection for front and side impact while it was installed using ISOFIX anchorages and top tether. The dynamic performance of the 18 months child restraint was also good for frontal and side impact protection as the CRS were installed using the ISOFIX anchorages and support leg. The car does not offer 3-point belts in all seating positions as standard in all versions. It was not possible to disconnect the passenger airbag in case a rearward facing CRS will be installed in this position. ISOFIX marking did not meet Latin NCAP requirements. The CRS installation pass for all CRS assessed. All the above explains the 4 stars for Child Occupant protection.



Latin NCAP

Joaquín Nuñez 2719 Of. 210. ZC 11300. Montevideo, Uruguay
T. +598 2716 8749 | secretaria@latinncap.com