



Nissan Murano + 7Airbags (from 6/10/2017)
VIN 5N1TANZ52JN100879



28.72 max. 34.00 - Adult Occupant



34.66 max. 49.00 - Child Occupant

 **CAR DETAILS**

Tested model: Nissan Murano

Year of publication: 2017

Made in: United States

Body type: 5 door SUV

Crash test weight: Kg 2074

Test valid for: Latin NCAP market


 **SAFETY EQUIPMENT**

Driver frontal airbag	YES	Driver knee airbag	YES
Front passenger frontal airbag	YES	Front seatbelt pretensioners	YES
Side head airbags DRIVER	YES	Front seatbelt pretensioners pass	YES
Side head airbags PASSENGER	YES	SBR	YES
Side body airbags DRIVER	Chest-Pelvis	ISOFIX anchorages	YES
Side body airbags PASSENGER	Chest-Pelvis	ABS (4 channel)	YES
Side Curtain airbags	YES	ESC (UN13 or GTR8)	YES



ADULT OCCUPANT PROTECTION


ODB FRONTAL

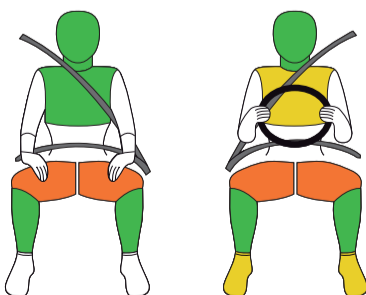


FRONT PASSENGER

DRIVER

MBD SIDE

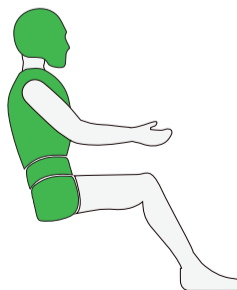

POLE SIDE

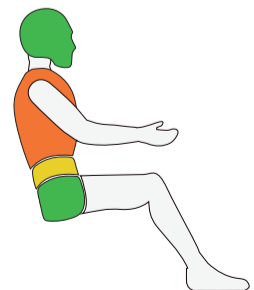

PROTECTION ■ GOOD ■ ADEQUATE ■ MARGINAL ■ WEAK ■ POOR

BODYSHELL INTEGRITY **STABLE**

SIDE IMPACT PROTECTION (STRUCTURAL) **YES**

COMMENTS

Adult occupant: Frontal impact: The protection offered to the driver and passenger head and neck was good. Chest protection for driver was adequate and good for the passenger. Both passenger's knees showed marginal protection being exposed to reach dangerous structures behind the dashboard, Driver and Passenger tibias show good protection. The bodyshell was rated as stable. Footwell area is rated as unstable. Side impact: The side chest- pelvis airbags with the curtain airbags offered good protection to the adult in head, chest, abdomen and pelvis. Head received good protection in the side pole impact test. ESC: is standard equipment. The ESC was tested and its performance met the regulatory requirements of Latin NCAP. All of the above explain the five stars for adult occupant protection. Considering all the above the Murano as from VIN 5N1TANZ52JN100879 (production from October 6 2017) reached the five star result for Adult Occupant Safety.



CHILD OCCUPANT PROTECTION

Dynamic score:
22.09 (max 24)

Installation score:
10.57 (max 12)

Vehicle assessment score:
2.00 (max 13)

CHILD RESTRAINT SYSTEM

	CHILD RESTRAINT	DYNAMIC SCORE	CRS TYPE	ADJUST	POSITION
18 month old child	Römer BabySafe + ISOFIX Base	Frontal 8.00 (8 max) Side 4.00 (4 max)	0+	ISOFIX/LEG	RWF
3 year old child	Römer Duo Plus	Frontal 6.09 (8 max) Side 4.00 (4 max)	0+/1	ISOFIX/TT	FWF

CRS INSTALLATION ASSESSMENT

REFERENCE LIST		2ND ROW			
		RIGHT	LEFT	CENTER	RIGHT
Group 0+	Peg Perego Viaggio Switchable	Exempt	Pass	Exempt	Pass
Group 0+	Roemer Baby Safe	Exempt	Pass	Exempt	Pass
Group 0+	Bébé Confort Streety Fix / Maxi Cosi Citi SPS	Exempt	Pass	Exempt	Pass
Group I	Peg Perego Viaggio Switchable FWF	Exempt	Pass	Exempt	Pass
Group I	Graco Cadeira Nautilus FWF	Exempt	Pass	Exempt	Pass
Group II/III	Burigotto Multipla 1,2,3	Exempt	Fail	Exempt	Fail
Group II/III	Graco Cadeira Nautilus	Exempt	Pass	Exempt	Pass
MANUFACTURER		RIGHT	LEFT	CENTER	RIGHT
Q1.5	Römer BabySafe + ISOFIX Base	Exempt	Pass	Exempt	Pass
Q3	Römer Duo Plus	Exempt	Pass	Exempt	Pass

COMMENTS

Child occupant: -The child seat for the 3-year-old child was installed forward facing using the ISOFIX anchorages and Top Tether and was able to prevent forward movement beyond the excursion limits during the frontal impact. The Q1.5 was installed rearward facing using the ISOFIX base and support leg and its protection as also good during the frontal impact. Side impact: both child dummies were well protected in the side impact. Most of the CRSs that were assessed for installation pass. The marking and instructions in the car in relation to ISOFIX do not meet Latin NCAP requirements. CRS instructions are clear. The car does not have a passenger airbag disabling switch in case of installing a Rearward facing CRS in the passenger seat. The Murano offers 3-point belts in all seating positions as standard, and all of them meeting technical international standards. All the above explains the three stars in Child Occupant Protection for the Murano as from VIN 5N1TANZ52JN100879 (production from October 6 2017).



Latin NCAP

Joaquín Nuñez 2719 Of. 210. ZC 11300. Montevideo, Uruguay
T. +598 2716 8749 | secretaria@latinncap.com